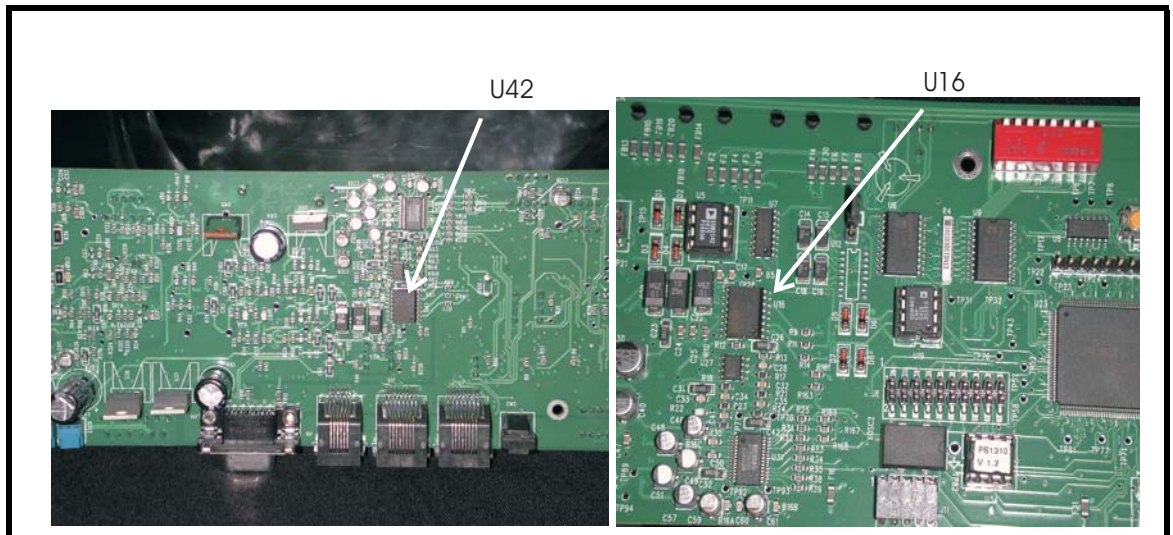

KP32 Loss of Audio and Boot Download Failures

CS3310 Modifications

ISSUE: Loss of audio and boot download failures.



FIX:

- Locate components U16 and U42 (see above) on the 9030-7656-001 KP-32 board.
 - If U16 and U42 are TI part **PGA2311U**, they need to be replaced with **CS3310-KS**.
 - The Telex part number for the CS3310-KS is 5110720-000.
 - For factory replacement of the ICs, please contact:

Telex Communications, Inc.
8601 East Cornhusker Hwy
Lincoln, NE 68507
402-467-5321